


Top View





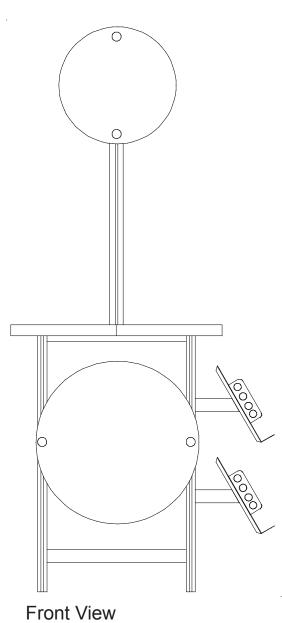

## **General Setup Instructions**


- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.




- For Cleaning Metal, Plex, & Laminate Parts: Use a **MILD NON-ABRASIVE** cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure.
   Heat and UV exposure will warp and fade components.
- Retain all provided Packing Materials.
   All provided packing materials are for ease of repacking & component protection.

# Disassembly

- For loss prevention, tighten all setscrews and locks during disassembly

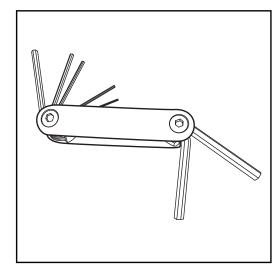


Hex Tool - Essential for Assembly

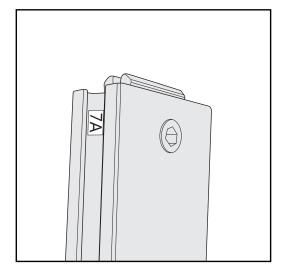


Part Identification - Numbering



# MARNING

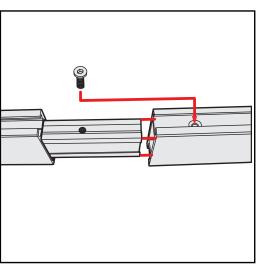

**Spline Connection** 

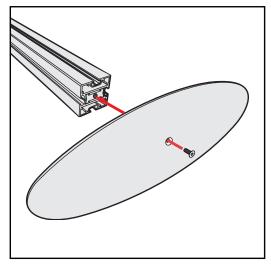


Base Plate & Extrusion Connection




DO NOT USE POWER TOOLS



LADDERS OR LIFTS MAY BE REQUIRED

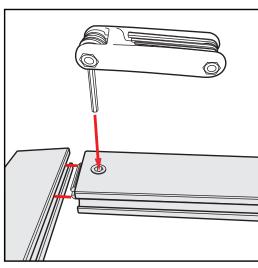

Extrusion & Lock Connection

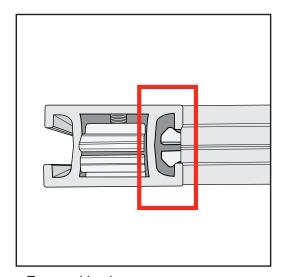

Engaged Lock



ALL CONNECTIONS MUST BE TIGHTLY SECURED


## **Order #XXXXX** Workstation Assembly


Item	Qty.	Description
1	1	36"h Vertical Extrusion w/ Door Hinges
2	1	36"h Vertical Extrusion w/ Door Stop
3	1	36"h Vertical Extrusion
4	1	36"h Vertical Extrusion
5	2	19"w Horizontal Extrusion
6	2	23"w Horizontal Extrusion
7	1	19"w Horizontal Extrusion
8	2	8.87"w Horizontal Extrusion
9	2	23"w Horizontal Extrusion
10	1	42.8"h Vertical Extrusion


### Steps

- 1) Attach horizontals [5] and [6] between verticals [1] [2] [3] and [4].

  Note: bottom of horizontals [6] should be on top of stoppers and 4" from floor.
- 2) Set Floor onto lips of horizontals [6].
- 3) Slide infill panels between verticals [1] [2] [3] and [4].
- 4) Attach horizontal extrusions [7] [8] and [9] between verticals [1] [2] [3] [4] and on top of infills and door.
- 5) Connect vertical [10] between horizontal extrusions [8].

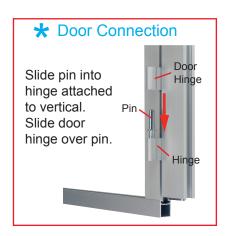

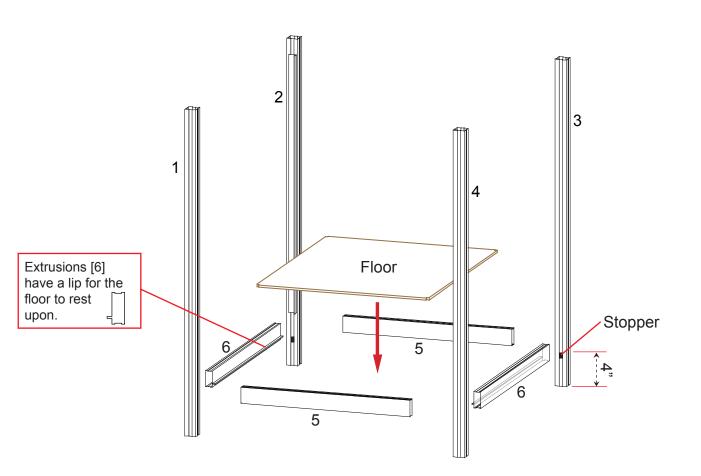

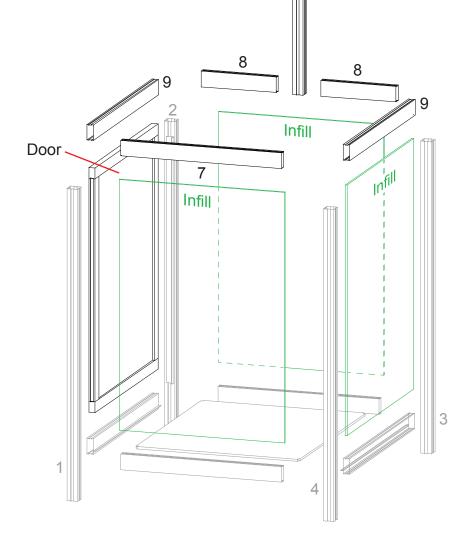

Connectors for

Monitor Mount


/ Attachment

10



#### Steps

- 1) Velcro shelf supports to inside of assembled base.
- 2) Set internal shelf on top of supports.
- 3) Slide counter top on vertical extrusion [10] and set on assembled base.
- 4) Attach graphics to extrusions [10] & [1] [4]. See Graphic Attachment detail.
- 5) Attach literature holders to extrusion [4]. See Literature Holder Attachment detail.
- 6) Attach monitor mount to extrusion [10]. See Monitor Mount detail.

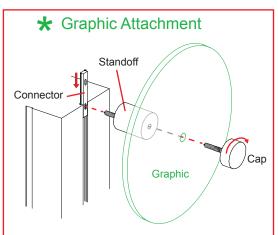

Slide Connector into groove of extrusion. Tighten set screws to secure in place. Screw Standoff into Connector. Place Graphic between Standoff and Cap, then screw Cap to tighten in place.

